

Date: Wednesday, 29/04/2009 3:01:45 PM
 User: Julie Dawson

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	SKID TUBE ASSEMBLY
Job Number :	47599		
Estimate Number :	10023		
P.O. Number :		Part Number :	D205634041
This Issue :	29/04/2009	S.O. No. :	
Prsht Rev. :	NC	Drawing Number :	D2580 REV D
First Issue :	/ /	Project Number :	N/A
Previous Run :	47598	Drawing Revision :	F
	Type :	Material :	
	SKIDTUBES	Due Date :	05/05/2009
Written By :		Qty:	1
Checked & Approved By :	JUD 09.04.29	Um:	Each
Comment :	Est Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ Est Rev: O 06.02.28 Added paperwork EC Est Rev:P 07-07-09 SS Wearplates & Gaskets JLM Est Rev:Q 09-03-19 rev.f as per IIN DD verified by:EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



for JUD 09/05/27



Comment: DOCUMENT CONTROL
 Photocopy D205-634 bluefile & type labels per PPP D205-634-041 CHG002

2.0	D25001190	Ext'n - I Beam Tube 4"
-----	-----------	------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2500-1-190	Skid Tube Extrusion	B 46482 D M 9-5-11

3.0	D2596	Web, 205 Skidtube
-----	-------	-------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2596	205 Web	B 47679 M 09-05-12 (2)

4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage

2-Cut D2500-1-190 per Dwg D2580 if necessary Deburrr ends

3-Acid etch and Alodine tube per QSI 005 4.1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/04/2009 3:01:45 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 47599

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BE 9-5-11

6.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

MA-5-11

2-Open holes to 0.500" as per Dwg D2580without cutting fluid

BE 9-5-11

3-Countersink holes as per Dwg D2580without cutting fluid

BE 9-5-11

4-Deburr and blow out all chips from inside of tube

BE 9-5-11

5-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 millo81

Sikaflex expire date: 10-01-20

Start Time: 8:00 Date: 09-05-12

Fin Time: 7:00 Date: 09-05-13

pmc 09-05-12 @

7.0

BENDING

BENDING MACHINE - SKIDTUBES



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

RT 09-05-13

8.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends

2-Prepare tube for welding, remove alodine as required.

M/B 09-05-13 @

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/04/2009 3:01:46 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 47599

Part Number: D205634041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

[Handwritten signature]

5 09/05/14

10.0

D25763

Step (machining detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2576-3	Step	<i>B-43504</i>

2E 09/05/14

11.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
20	D2579	Spacers	<i>B-46434</i>

MB 09-05-13

(20x)

12.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

m111679

2E 09/05/14

3-Prep per QSI 005 and weld crossbolt spacers D2579 as per Dwg. D2580, QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

m111679

2E 09/05/14

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

5-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64", adjust stopper not to hit web. Debur

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Debur holes

7-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Debur

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Debur

- AWM9-5-15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/04/2009 3:01:46 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 47599

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

8 09/05/25 @

14.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

8 09/05/25 @

15.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

BR 09-05-26

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

START TIME: 9:30am

OVEN TEMPERATURE: 320°F

FINISH TIME: 10:00am

BR 09-05-26

①

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BR 09-05-26

①

18.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: B4234B

BR

19.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: M100188

BR

①

BR 09-05-26

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 47599

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

AN960JD10L

Washer

*



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch: M101340

BR

21.0

ALS71032130

Insert

*



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

Insert

Batch: M110511

BR

22.0

AN3C4A

BOLT



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

BOLT

Batch: M111668

BR

23.0

AN960C10L

washer



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

washer

Batch: M117668

BR

24.0

D356613

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B46889

BR

25.0

D35665

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B47318

BR

26.0

D35661

Gasket



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

GASKET

Batch: B47434

BR

BR 09-05-26^①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 47599

Part Number: D205634041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

27.0	D356413	Wearshoe
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B46183

BR

28.0	D356411	Wearshoe
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B47012

BR

29.0	D35649	Wearshoe
------	--------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B46888

BR

30.0	D35645	Wearshoe
------	--------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B47433

BR

31.0	D25943	O-Ring, 205 Skidtube
------	--------	----------------------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

O-Ring

Batch: B29908

BR

32.0	D25941	Plug, 205 Skidtube
------	--------	--------------------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Plug

Batch: B43884

BR

33.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R

Sikaflex-291

M111081

BR 09-05-26

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/04/2009 3:01:46 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 47599

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

Sikaflex expire date: 10/20

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 M111081

Sikaflex expire date: 10/20

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch: M111013

BR 09-05-27

34.0

QC5

INSPECT WORK TO CURRENT STEP



Solitary



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

35.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location:

PPP Rev: I

14/05/09

36.0

QC21

FINAL INSPECTION/W/O RELEASE



09/05/29

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF 09-05-28

47599

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART

DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

RELEASED
07-06-28 *[Signature]*

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

GENERAL NOTES:


- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
SEE NOTES ON
PAGE 2 FOR D2580-041 AND
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. *41599*


Copyright © 1996 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.


DETAIL A
SCALE 5:24

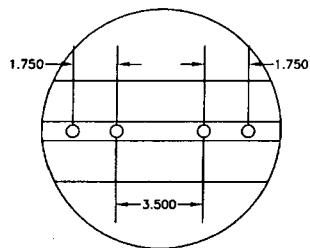


DETAIL B
SCALE 5:24

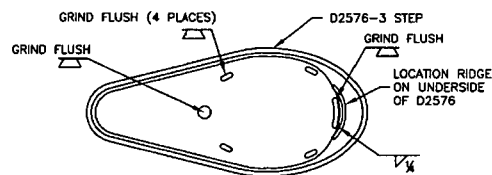


D2580-1 DRILLING DETAIL

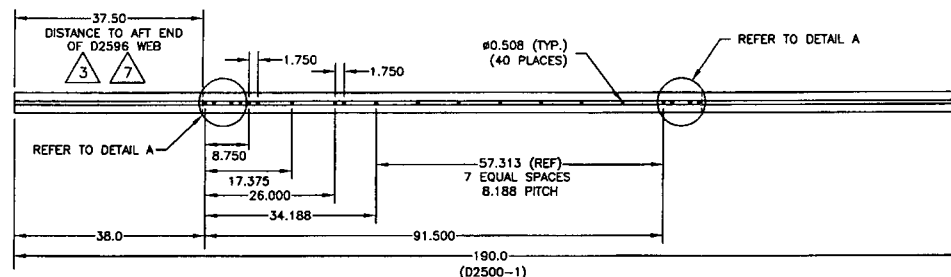


D2580-1 BENDING AND CUTTING DETAIL

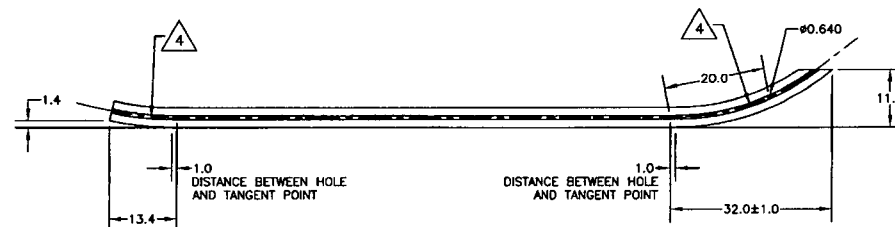


D2580-041 ASSEMBLY DETAIL

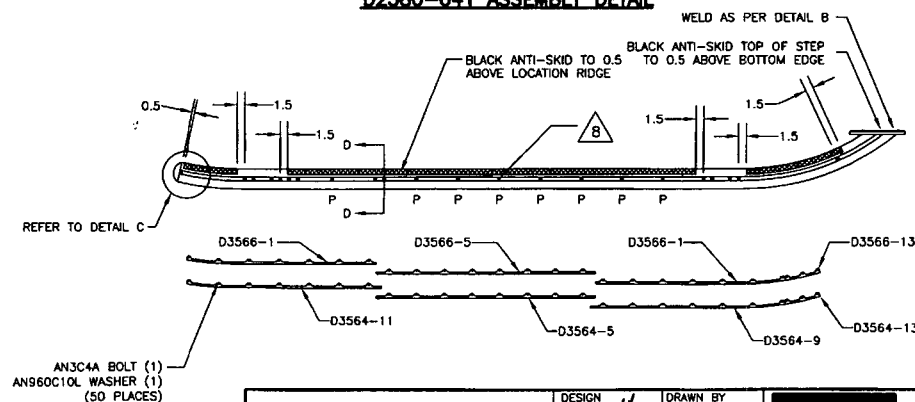

DETAIL C
SCALE 5:24

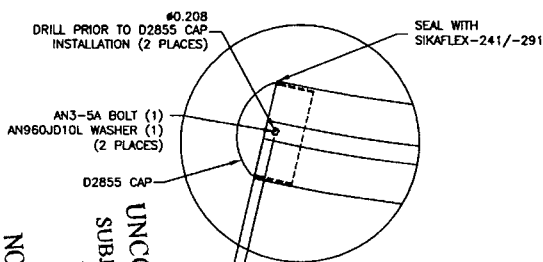

SECTION D-D
SCALE 5:24

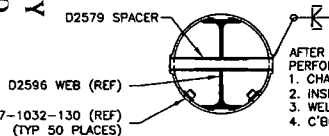

AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO #0.437 X 1.00 DEEP

NO. 14588
WORK ORDER
WITHOUT NOTICE
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
RETURN TO
ENGINEERING
SHOP COPY

D2580-041 NOTES

- i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

COPYRIGHT © 1996 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN	DRAWN BY	DART	DART AEROSPACE LTD. HARRISBURG, ONTARIO, CANADA
CHECKED	APPROVED	DRAWING NO.	REV. D
DATE	07.02.27	D2580	SHEET 2 OF 3
		TITLE	SCALE
		205 SKIDTUBE ASSEMBLY	1:24

RELEASED
07 Dec 28

Diagram illustrating the grinding locations on the propeller hub. The hub is shown in cross-section, highlighting the following areas for grinding:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- GRIND FLUSH
- LOCATION RIDGE ON UNDERSIDE OF D2576

#0.208
DRILL PRIOR TO D2855 CAP
INSTALLATION (2 PLACES)

SEAL WITH
SIKAFLEX-241/-291

AN3-5A BOLT (1)
960JD10L WASHER (1)
(2 PLACES)

SEE NOTE ii)

D2855 CAP

UNCL
SUB

62579 SPACER

WEB (REF)

130 (REF)

0 PLACES

AFTER PERFORM

1. CHA
2. INS
3. WEI
4. C'B

1. CHAMFER HOLE 0.050 X 45°

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

ii) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE
WITH THE SPACER AT THIS LOCATION

[illegible]


(MAKE FROM D2580-1 DRILLING DETAIL)

Technical drawing of a curved pipe section. Dimensions and callouts include:

- Overall length: 51.340
- Distance from left end to first hole: 5.985
- Distance between first and second holes: 5.338 (REF)
- Distance from second hole to third hole: 39.580
- Distance from third hole to fourth hole: 5.915
- Distance from fourth hole to end: 20.0
- End radius: $\phi 0.640$
- End height: 11.0
- Callout 4 (triangle symbol) points to the left end and the end radius.
- Callout 4 (triangle symbol) points to the first hole.
- Callout 4 (triangle symbol) points to the third hole.
- Callout 4 (triangle symbol) points to the end radius.
- Dimension 1.4 is shown at the left end.
- Dimension 1.0 is shown between the first hole and the tangent point.
- Dimension 1.0 is shown between the third hole and the tangent point.
- Dimension 13.4 is shown from the left end to the first hole.
- Dimension 32.0 \pm 1.0 is shown from the third hole to the end.
- Dimension $\phi 0.508$ (8 PLACES) is shown for the third hole.
- Text: "1.0 DISTANCE BETWEEN HOLE AND TANGENT POINT" is shown twice.

[illegible]

 THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN <i>RH</i>	DRAWN BY <i>RH</i>	 DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>H</i>	APPROVED <i>H</i>	DRAWING NO. D2580	REV. 0 SHEET 3 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE 1:24

NO. 199

**AWS D17.1.2001
QUALIFICATION TEST RECORD**

Name: Barclay Elliott
Job number: D205 57598
Part number: D205 563 011
Description: 205 skid tube
Welding Process: Tig[☒] Mig[☐]
Base material: Aluminium
Current: AC[☐] DC[☐]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[☐]
Penetration: pass[☒] fail[☐]

UNACCEPTABLE

Cracks: pass[☒] fail[☐]
Undercut: pass[☒] fail[☐]
Pin holes: pass[☒] fail[☐]
Overlap (cold lap): pass[☒] fail[☐]
Porosity (surface): pass[☒] fail[☐]
Coloration: pass[☒] fail[☐]

Qualifier [Signature] Date of Test Coupon 09.04.27
Welder Barclay Elliott Date of Test Coupon 09.04.27

The above named individual is qualified in accordance with AWS D17.1.2001 to weld